

General Welder Intermediate Trade Test Mock Practical Test Paper

Disclaimer

No part of this material may be reproduced or transmitted in any form or any means without the written permission of the CIC. Whilst reasonable efforts have been made to ensure the accuracy of the information contained in this material, the CIC nevertheless would encourage readers to seek appropriate independent advice from their professional advisers where possible and readers should not treat or rely on this material as a substitute for such professional advice for taking any relevant actions.

Enquiries

Enquiries on this Material may be made to the Trade Test Centre at:

95, Yue Kwong Road Aberdeen Hong Kong

Tel: (852) 2100 9232 Fax: (852) 2100 9249 Email: enquiry@cic.hk Website: www.cic.hk

© 2015 Construction Industry Council.

Intermediate Trade Test

Post : General Welder

Grade: Semi Skilled Worker

Test Content : Complete the following items at designated location:

- a. Select suitable electrode, adjust current, fix the steel plates by tack weld and full weld in flat position.
- b. Set up & check cutting device properly, adjust the pressure and light. Cut the work piece according to the lines. Upon completion, disassemble the cutting device.

Duration: 3 hours

Notes : (a) Candidate shall read the attached test requirements

carefully

(b) Candidate will be marked as fail if he does not carry out

safety precautions during the test;

(c) The test paper consists of 4 pages. Total score is 100.

Passing mark is 60.

Intermediate Trade Test


Post : General Welder

Grade: Semi Skilled Worker

Working Drawing No. 1

Specifications & Requirements

- 1. Weld in flat position after the work pieces have been connected by tack weld.
- 2. All welds are full weld.
- 3. Leg length 5mm to 8mm
- 4. All welds shall be free from defects.
- 5. Upon completion, remove all slags and spatters.

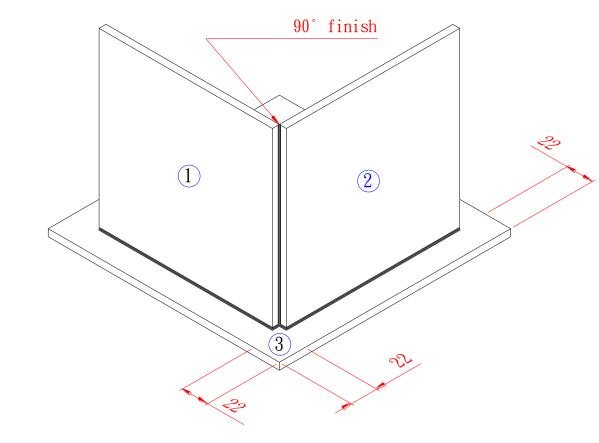

Material	Dimensions/Specification
Mild Steel Plate	150 x 150 x 6
Mild Steel Plate	200 x 200 x 6
Electrode	E6013, Ø 3.2

All dimensions are in mm. N.T.S.

Page 2 / 5

Intermediate Trade Test


Post: General Welder

Grade: Semi Skilled Worker

Working Drawing No. 2

Specifications & Requirements

- Cut the work piece along the lines drawn on the plate
- 2. Candidate is required to work on floor.
- 3. Tolerance of kerf's straightness shall not exceed 3mm.
- 4. Width of kerf shall not exceed 4mm.
- 5. Perpendicular of kerf shall not exceed 2.5mm.
- 6. The slag attached on the bottom of kerf shall be removed.

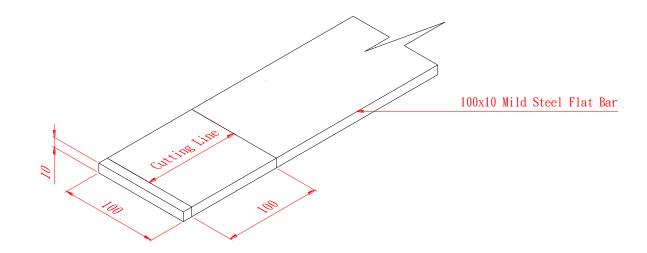

All dimensions are in mm. N.T.S.

Notes to Candidates:

- Candidates should read the test papers carefully and ask the invigilator for any queries.
- 2. Candidates should study the drawings and specifications attached to test papers, if any, before the test begins.
- 3. Candidates should carry out the test according to test papers, working drawings and specifications provided.
- 4. Candidates shall bring their own safety shoes, other safety equipment will be provided by trade testing centre. Candidates must take all necessary safety precautions to ensure work safety.
- 5. All tools and materials required by the test will be provided by trade testing centre, candidates should check and ensure their adequacy and quality. Candidates shall use the tools and materials properly based on trade practice. All the tools must be returned to trade testing centre after the test. The candidates may ask the invigilator for any problems.
- 6. Candidates are required to handle and move the tools and materials for use in the test, and to carry out associated works.
- 7. Invigilator will take record photos periodically during the test.
- 8. Candidates are not allowed to take any photo or video with cameras or mobile phones.
- 9. Candidates are not allowed to use their mobile phones during the trade tests, except for emergency situation.
- 10. The marking scheme is based on the following criteria:

- a) Understanding of drawing and specification
- b) Preparation works before commencement of test
- c) Working procedures
- d) Accuracy and quality of works
- e) Progress of works
- f) Proper handling and use of materials
- g) Proper use of tools and equipment
- h) Safety precautions
- i) Considerate of other trades
- h) Housekeeping after completion of test
- 11. All candidates must stop when time is up.
- 12. Candidates are required to return the test paper to invigilator after the test.
- 13. Offering bribe to invigilator is an offence in law and trade testing centre will report to the ICAC for any such case.

In the event that the candidate fails to take any necessary safety precautions and / or works in any dangerous situations, he / she will be assessed failed